FSC:8010

NIIN:01-367-2377

Kit Part:Y

MSDS Number: BWFRJ === Responsible Party === Company Name:HANOVIA Address:100 CHESTNUT

City:NEWARK

State:NJ ZIP:07105 Country:US

Info Phone Num:201-589-4300

Emergency Phone Num:908-442-4900

CAGE:29218

=== Co

ntractor Identification === Company Name:HANOVIA Address:100 CHESTNUT Box:City:NEWARK

State:NJ ZIP:07105 Country:US

Phone:201-589-4300

CAGE:29218

======= Composition/Information on Ingredients ========

Ingred Name: WATER (NON-HAZARDOUS)

CAS:7732-18-5

RTECS #:ZC0110000 Fraction by Wt: 36.58%

Other REC Limits: NONE RECOMMENDED

Ingred Name: ETHELENE GLYCOL BUTYLETHER

CAS:111-76-2

RTECS #:KJ8575000 Fraction by Wt: 3.53%

Other REC Limits: NONE RECOMMENDED


OSHA PEL:25 PPM ACGIH TLV:25 PPM Ingred Name:ZINC SULFIDE CAS:68611-70-1 Fraction by Wt: 1.19% Other REC Limits: NONE RECOMMENDED Ingred Name: VOC: 1.26 LBS/GAL RTECS #:9999999VO Other REC Limits: NONE RECOMMENDED Reports of Carcinogenicity:NTP:NO IARC:NO OSHA:NO Health Hazards Acute and Chronic: VAPORS MAY IRRITATE EYES, SKIN AND RESPIRATORY TRACT. EXPOSURE/INGESTION MAY CAUSE HEADACHES, DIZZINESS, NAUSEA. CONTACT MAY CAUSE SKIN IRRITATION, OR ALLE **RGIC** SKIN REACTIONS. THIS IS A CHEMICAL SUBST ANCE. CAUTION AND COMMON SENSE WILL HELP. PROTECT AGAINST OVER-EXPOSURE. SEE SAFETY INSTRUCTIONS ON LABEL. Effects of Overexposure: EYE IRRITATION, SKIN IRRITATION, ALLERGIC SKIN REACTION, HEADACHES, DIZZINESS OR NAUSEA. First Aid:INHALATION: MOVE TO FRESH AIR. EYE CONTACT: FLUSH WITH WATER (LIFT LIDS) FOR FIFTEEN MINUTES. SKIN CONTACT: WASH AFFECTED AREAS ITH SOAP AND WATER, REMOVE CONTAMINATED CLOTHING. AVOID CONTACT WITH SK IN OR EYES. IF BREATHING IS DIFFICULT, GIVE OXYGEN. Extinguishing Media: NOT A PRIMARY FIRE HAZARD DUE TO WATER CONTENT. WATER SPRAY, HALON. Fire Fighting Procedures: USE WATER FOG TO COOL CONTNRS. USE WATER SPRAY TO DILUTE SPILLS.FIGHT FIRE FROM SAFE DISTANCE.COOL FIRE EXPOSED CONTAINERS W/WATER SPRAY.NOT PRIMARY FIRE SOURCE.

Unusual Fire/Ex

plosion Hazard: VAPORS CAN BE IRRITATING TO BOTH EYES AND SKIN. THIS PAINT SHOULD NOT BURN BUT MAY SPATTER IF ITS TEMPERATURE EXCEEDS THE BOILING POINT.

======== Accidental Release Measures ===========

Spill Release Procedures: ABSORB W/SAND & DISPOSE IN APPROVED MANNER.
DIKE AREA W/SAND TO CONTAIN LIQUID. RECOVER FREE-PRODUCT. VENT
CONFINED SPACES. OPEN WINDOWS & DOORS. USE WATER SPRAY TO DILUTE
SPILL. PREVENT MAT'L FROM EN TERING WATERWAYS. USE WATER SPAR

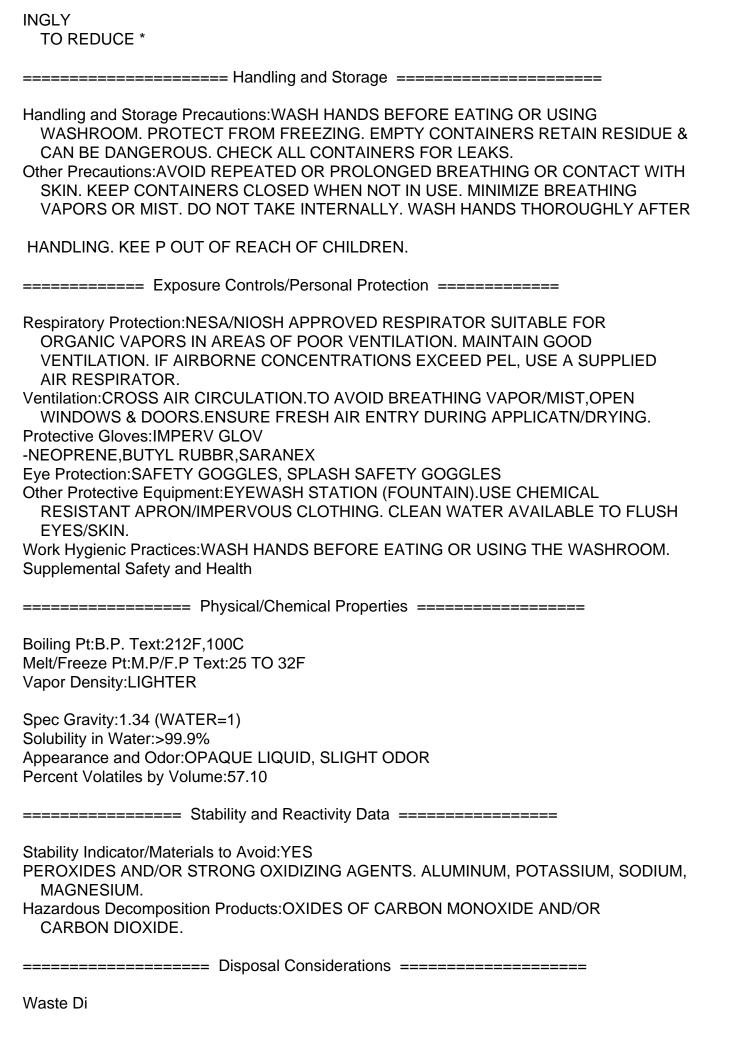

sposal Methods:DISPOSE OF IN ACCORDANCE WITH LOCAL REQUIREMENTS. ASSURE CONFORMITY WITH APPLICABLE GOVERNMENT REGULATIONS.

* DISPOSAL REQUIREMENT S. FLUSH THE CONTAMINATED AREA WITH WATER SPRAY.

Disclaimer (provided with this information by the compiling agencies): This information is formulated for use by elements of the Department of Defense. The United States of America in no manner whatsoever, expressly or implied, warrants this information to be accurate and

disclaims all liability for its use. Any person utilizing this document should seek competent professional advice to verify and assume responsibility for the suitability of this information to their particular situation.